

Technical Service Bulletin

MODEL(S) AFFECTED: **Tennant T3 Scrubber Dryer** (Models manufactured before mid November, 2005.)


SUBJECT: Recovery tank drain hose damage.

PURPOSE: To prevent drain hose damage, the removal of rotomold material is required as described below.


NOTES: During routine maintenance visits inspect the drain hose passage and modify if needed. For questions, contact the Tennant Customer Service Department at (800) 553-8033 or (763) 513-2850.

If you have experienced drain hose damage, perform the following procedure:

Using a round file or dremel, carefully add a 1/4" radius to the upper edge of the passage as shown below. This will allow the drain hose to slide freely through the passage when the recovery tank is lifted up and down.

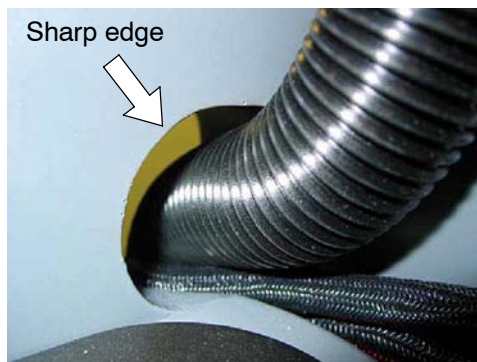

BEFORE

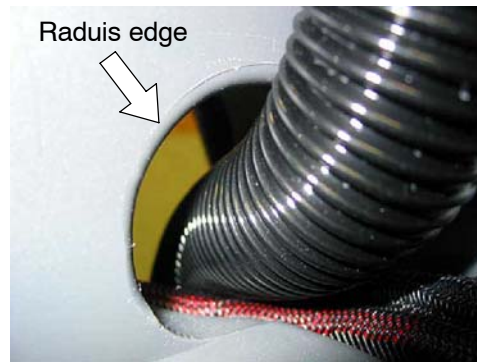

AFTER

