
Release Date: May 27, 2010



Technical Service Bulletin

MODEL(S) AFFECTED:	T5 and T5e models NA and International models manufactured before serial number 10473940 (May 14, 2010) European models manufactured before serial number T5xxx06108 (May 14, 2010)
SUBJECT:	The hardware used to fasten the 100A fuse to the stand-off has changed to ensure a tight fuse connection (see diagrams below).
PURPOSE:	This change was required because the stand-off may have plastic backfill within the threaded insert causing the screw to bottom out prematurely thus preventing a tight fuse connection.
NOTES:	For questions, contact the Tennant Customer Service Department. Warranty Information: Standard Terms Apply.

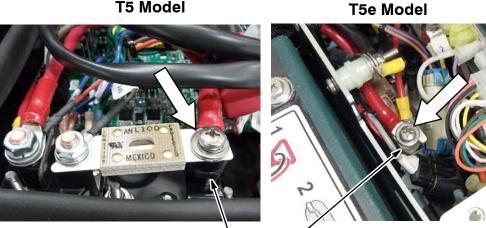



Plastic Backfill Stand-Off (Side view)

Stand-Off

