

Technical Service Bulletin

MODEL(S) S5 and S9 Walk- Behind Sweepers

AFFECTED: Machines manufactured before following serial numbers (October 10, 2013).
S5 s/n: S5001996, S9 s/n: S9001878

SUBJECT: Potential loss of main brush drive function due to pulley failure. If pulley is overloaded, the motor shaft may gradually strip out the square drive slot resulting in pulley failure.

PURPOSE: If you experience the above condition, install the upgraded motor pulley included in the following pulley kits. The upgraded pulley has been redesigned to withstand excessive overload. The material strength was increased, the motor shaft slot is tighter and the metal retaining plate was enlarged to add strength around the square drive slot.

NOTES: **Warranty Information:** Standard warranty terms apply.

Motor Pulley (Discontinued)



Upgraded Motor Pulley



S5 Pulley Kit: 9010170
S9 Pulley Kit: 9010165

IMPORTANT: Use a thread- locking compound to secure pulley screw.