


# Technical Service Bulletin


**MODEL(S) AFFECTED:** **T1 Corded Floor Scrubber, E5 Carpet Extractor and R3 ReadySpace Carpet Cleaner**

**SUBJECT:** If you are experiencing wall outlets equipped with ground fault circuit interrupter (GFCI)/residual-current device (RCD) tripping while operating machine, the brush motor(s) may be subject to current leakage due to excessive carbon brush dust buildup.

**PURPOSE:** If you have experienced the above condition, order new replacement motor, see list below, to resolve issue. The carbon brush holders are modified and a di-electric coating is included inside end-bell on new motor. The new brush motors were implemented into production starting in May through October of 2013.


**NOTES:** **Warranty Information:** Standard warranty terms apply.

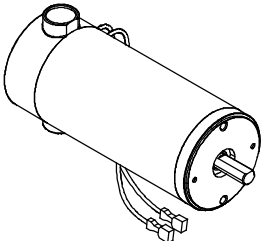New Brush Motor Replacement				
	<u>Models</u>	<u>120V Motor p/n</u>	<u>230V Motor p/n</u>	<u>Replacement Carbon Brush Kit</u>
	<b>T1</b>	1072719	1072720	1067897
	<b>E5</b>	1072719	1072720	1067897
	<b>R3</b>	1072721 (2)	1072722 (2)	1067897

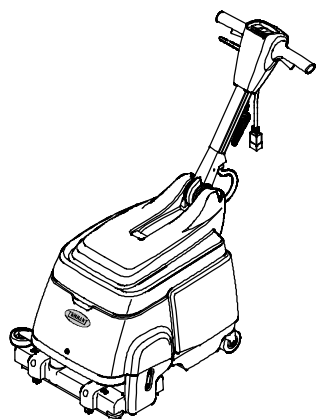


### T1 Model Part Numbers

9004191 (120V)  
9004195 (230V)

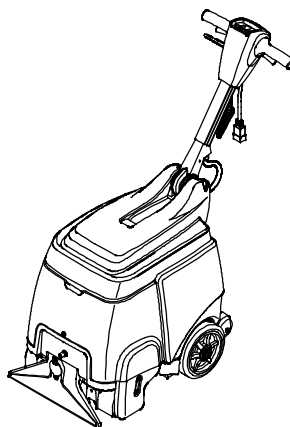

### E5 Model Part Numbers

9004194 (120V)  
9004198 (230V)

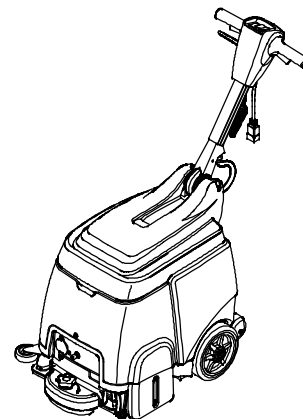

### R3 Model Part Numbers

9004192 (120V)  
9004199 (230V)