

## Technical Service Bulletin

**MODEL(S) AFFECTED:** **T300/T300e Magnetic Single Disk Models**

Models manufactured before serial number 10745235 (May 08, 2015)

**SUBJECT:** The magnetic pad driver/brush may possibly disengage if machine is operated on uneven floor surfaces with low down pressure.


**PURPOSE:** To prevent the magnetic pad driver/brush from disengaging in this condition, perform the following procedure.

**NOTES:** **Warranty Information:** Standard warranty terms apply.

### Procedure:

**FOR SAFETY:** Before servicing machine, park machine on level surface, remove key and set parking brake if equipped.

1. Lower scrub head and remove front shroud.
2. Remove existing spring from head lift bracket and install lighter spring p/n 1032420.
4. With the scrub deck in the lowered position, slide the head lift glide back until there is a 5mm gap between the head lift bracket and glide. Re-tighten nut.

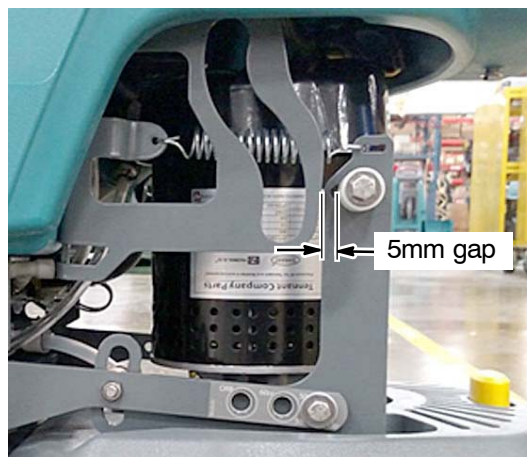

3. Using a 13mm wrench, loosen the nut on the head lift glide.

