

Technical Service Bulletin

MODEL(S) AFFECTED: T300 and T300e Walk-behind Scrubbers

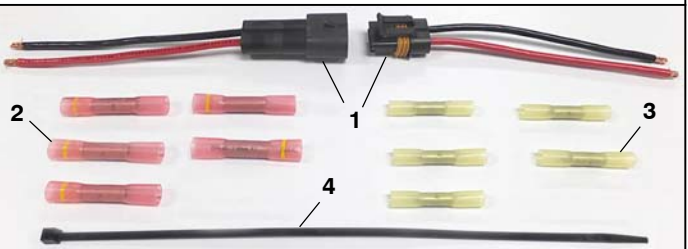
SUBJECT: Red Anderson brush motor connectors cracking. Research has discovered when the connectors are exposed to specific cleaning agents it may create a chemical reaction causing the plastic to become brittle and eventually crack.

PURPOSE: To repair cracked connectors, order the Brush Motor Connector Retrofit Kit 9014995. The retrofit kit includes a replacement connector assembly that is chemical resistant.
The machine harness and brush motor with the chemical resistant connector will be implemented into production later in the year.

NOTES: **Warranty Information:** Standard warranty terms apply.



9014995 Retrofit Kit Contents

		
Ref	Description	Qty.
1	Scrub Motor Connector Harness Assembly	1
2	8awg/10awg Red Butt-Splice Reducer Connector	5
3	10awg Yellow Butt-Splice Connector	5
4	Cable-Tie	1
	Installation Instructions (IB 9015011)	