

# Technical Service Bulletin

**MODEL(S) T300 and T300e Walk-behind Scrubbers**  
**AFFECTED:**

Models manufactured before following serial numbers/dates:  
Americas Models - s/n 10829529 / Dec 13, 2016  
EMEA Models - s/n U14350 / Nov 30, 2016  
APAC Models - Jan 15, 2017

**SUBJECT:** On-Board battery charger failure due to water ingress. The failure can occur if water enters through the console vents. This may be caused from over-spray when rinsing out the recovery tank, hosing off the machine or power washing the machine after use.

**PURPOSE:** To protect battery charger from water ingress, install warning label (p/n 1229725) as described below. The label serves two purposes. It warns the operator not to hose off or power wash the machine. It also acts as a water shield designed to cover the console vents. The charger still has adequate ventilation with vents covered. Charger performance and reliability are unaffected.

**NOTES:** **Warranty Information:** Standard warranty terms apply. Add label when servicing machine on a non-related issue. New on-board battery charger replacement kits will include label.

Install label - Clean the vented area on top of the console panel with Isopropyl alcohol and let surface dry. Adhere the warning label over the vents as shown.



The addition of the label also reinforces the following statement printed in the operator manual.

**FOR SAFETY LABEL -**  
Do not power spray or  
hose off machine.  
Electrical malfunction  
may occur.

