

Technical Service Bulletin

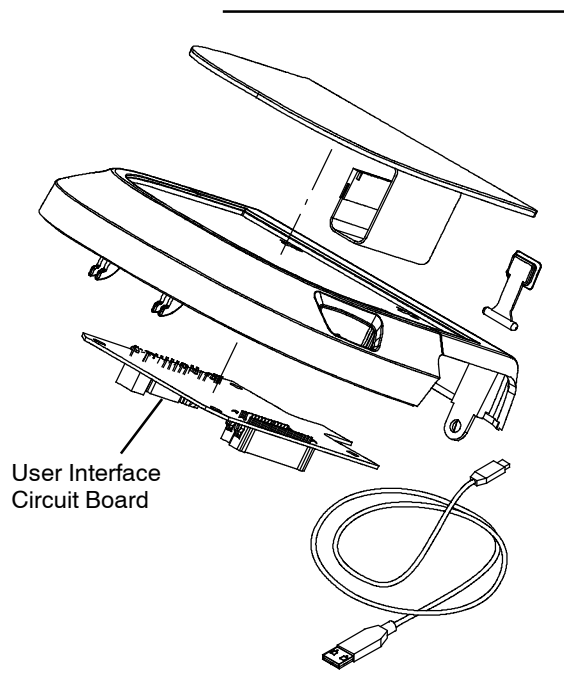
MODEL(S) T300e Walk-behind Scrubber
AFFECTED:

North America Models manufactured between s/n 10805959- 10812601 (July 15, 2016- Aug 5, 2016)

SUBJECT: Defective User Interface Circuit Board (PCB). While machine is on charge, the charger interlock function fails to disable the vacuum system. If the squeegee assembly is inadvertently lowered to the floor while the machine is charging, the vacuum motor will activate and could over discharge the batteries resulting in damage if left unnoticed after an extended period. In this situation, the charger is unable to properly function.

PURPOSE: To repair the defective circuit board, order the following bezel kits.

NOTES: **Warranty Information:** Standard warranty terms apply.

T300e Bezel Kit ContentsUser Interface
Circuit Board*Propel model bezel kit shown*

| Part No. | Description |
|----------|--|
| 9014130 | Bezel Kit, Membrane [T300e Push Model] |
| 9014131 | Bezel Kit, Membrane [T300e Propel Model] |

Description