


Technical Service Bulletin

MODEL(S) AFFECTED: T300/T300e Walk-behind Scrubber


SUBJECT: Disabled vacuum motor due to wire harness failure at squeegee lift bracket switch. Over time, as the squeegee lift bracket pivots from side to side, the squeegee lift bracket switch wiring may weaken and eventually break.

PURPOSE: To repair or prevent wire harness failure, order retrofit kit 9016739. The kit is designed to retain the squeegee switch connector wire harness as shown below.

NOTES: **Warranty Information:** Standard warranty terms apply.
A manufacturing change to add the retaining bracket and to lengthen the squeegee switch harness will be implemented into production in the near future.

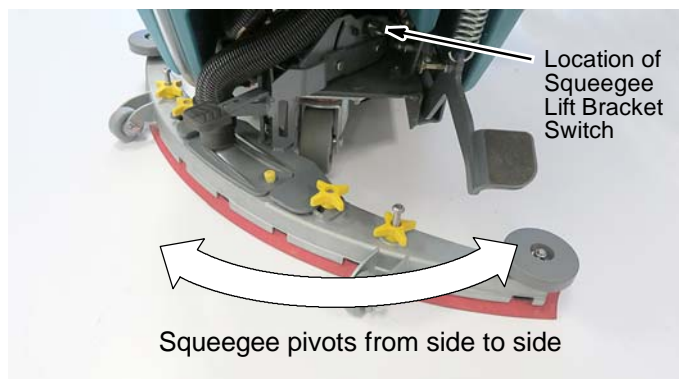


9016739 Retrofit Kit Contents

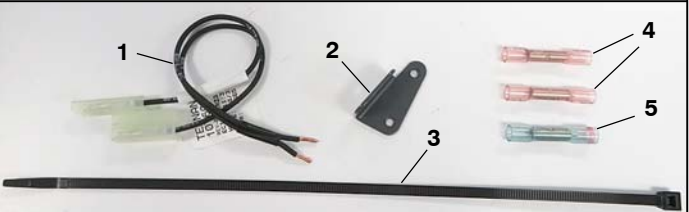

Ref.	Part No.	Description	Qty.
1	1076046	Harness, Extension	1
2	1233709	Bracket, Retaining, Wire	1
3	130773	Tie, Cable, Nyl, 11/0L, .14w, 3.0 Max. D	1
4	n/a	20awg (.518 mm ²) Red Butt-Splice Connector	2
5	n/a	18awg/20awg (.823 mm ² /.518 mm ²) Blue Butt-Splice Reducer Connector	1
	9016740	Kit Installation Instructions	

Squeegee Lift Bracket Switch wire harness connection

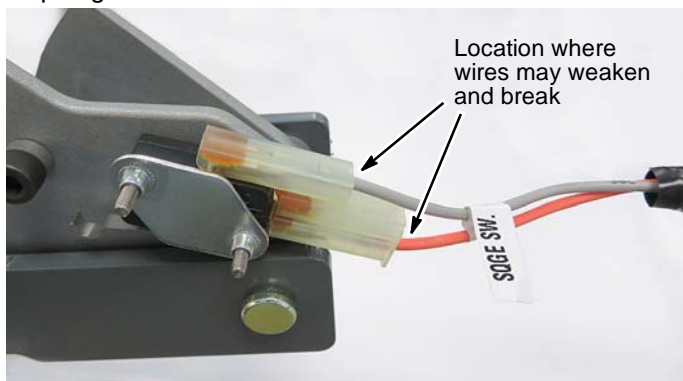

Retrofit Kit installed

