



# Technical Service Bulletin

**MODEL(S) AFFECTED:** T500/T500e Walk-Behind Scrubbers

**SUBJECT:** The bronze spacer located on the squeegee lift bracket spring guide may fail during normal operation over time. If spacer fails (cracks in half), the squeegee blade pressure that is applied to the floor will weaken and cause a reduction in solution pickup. The squeegee pedal may also fail to stay in the up position during transport due a failed spacer.

**PURPOSE:** To repair or prevent the above issue, order the Squeegee Bracket Spring Guide Kit 9016898. The new spring guide is designed to be used without a spacer.

**NOTES:** **Warranty Information:** Standard warranty terms apply.



Squeegee Lift Bracket Spring Guide



Bronze Spacer

## 9016898 Squeegee Bracket Spring Guide Kit Contents



1235860 Spring Guide (no spacer required)  
9016897 Installation Instructions



**Manufacturing Note:** As an interim upgrade prior to implementing the new spring guide into production, two stainless steel washers that equal the same thickness of the bronze spacer (to maintain the proper spring retention) were used as a replacement.

**Kit Installation Note:** The squeegee lift bracket must be removed from the machine in order to relieve tension on spring for spring guide removal. Follow the installation instructions supplied with kit.