

## Technical Service Bulletin

### MODEL(S) T350 Stand-on Scrubbers

**AFFECTED:** Models manufactured in N. America before S/N T350-10897605 (April 9, 2018)  
Models manufactured in Europe before S/N T350-U00186 (August 17, 2018)

**SUBJECT:** On-board battery charger failure due to potential voltage backfeed when reconnecting the double-pole battery cable connector. Machine fault code "0xF103"/"●●●●●●●●" (Charger CAN communication fault) will be detected.

**PURPOSE:** To repair a failed battery charger caused from voltage backfeed, order Battery Charger Retrofit Kit p/n 9017891. The retrofit kit includes the necessary parts to rework the battery cable configuration with single-pole battery connectors to prevent future battery charger failure.

**NOTES:** **Warranty Information:** Standard warranty terms apply.

#### Battery Charger Retrofit Kit (p/n 9017891)



#### On-Board Battery Charger Replacement Parts

Ref	Part No.	Description	Qty
1	1220856	Charger, 24vdc 25a 100-240vac (on-board)	1
2	26395-2	Clamp, Cable, Stl, 0.38dx0.38w, 1hole	1
3	1205799	Screw, Btn, m5x0.8x16, 8.8,nl torx	5
4	1210807	Wire, Tie [w/.25" fir tree clip]	2

#### Cable Connector Retrofit Parts

Ref	Part No.	Description	Qty
5	1020446	Connector, Anderson, 1321Series (single-pole)	4
6	1217818	Sleeve, Heatshrink, 1.5id, 07.0L	1
7	33931	Screw, Pan, Phl, m4x0.70x30, ss	2
8	1240380	Plate, Washer, Battery, Connector	1
9	1239877	Plate, Wldt, Mount, Battery Disconnect	1
10	763115	Tie, Cable, 6.0L, 1.25 max	1
	9017892	Kit Installation Instructions	

**Affected machines are equipped with double-pole battery cable connectors.**



**Picture of reworked machine with single-pole battery cable connectors.**

