

Release Date:  
Aug 02, 2021



## Technical Service Bulletin

### MODEL(S) T581 Rider Floor Scrubber

**AFFECTED:** Machines manufactured before the following serial numbers:  
North America - 1255470-00365 (July 15, 2021).  
EMEA - 9021379-00025 - 55cm model, 9021380-00022 - 70cm model (July 5, 2021)

**SUBJECT:** Potential propel power failure due to faulty wire harness connection.  
Small red wire pulling out of battery cable connector due to stress on wires.

**PURPOSE:** To prevent wire connection failure, adjust wire harness to relieve stress on red wires as described below.

**NOTES:** **Warranty Information:** Standard warranty terms apply.


### Faulty Wire Harness Connection

1. Inspect wire connection below. If wires are stressed, adjust harness as described.
2. If wire is pulled out or loose, repair connection and adjust harness to relieve stress on wires.
3. Replace connectors as needed.



### Harness Adjustment Instructions:

1. Cut cable-tie securing wire harness.
2. Adjust harness to relieve stress on wires as shown below.
3. Resecure wire harness with new cable-tie.

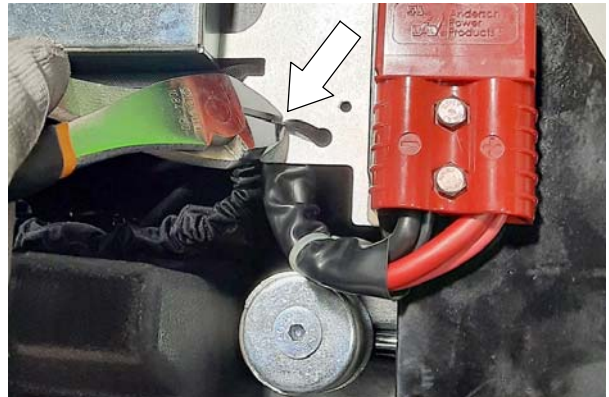

### REPLACEMENT PARTS



- 1 605387 Connector, Anderson, 050A, Red
- 2 605183 Contact, Plug, 06GA Wire

