

Technical Service Bulletin

**MODEL(S)
AFFECTED:****Tennant R14**

Machines manufactured before serial number 10309496 DC 1206 (Dec 29, 2006)

SUBJECT:

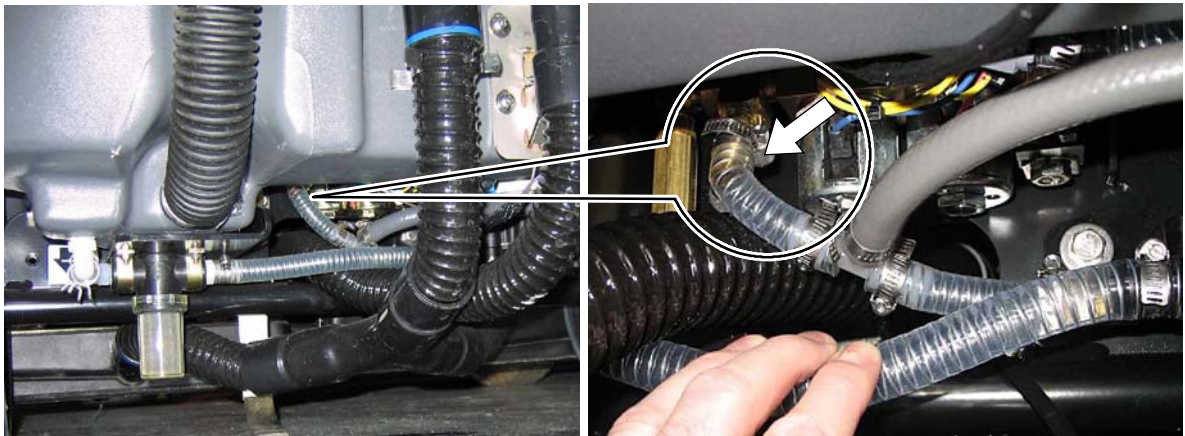
Solution Hose failure - Reports have been received that the solution hose routed to the solution tank fitting is splitting or bursting (see location below).

PURPOSE:

To repair or to prevent potential hose failure, install Solution Hose Kit p/n 9003386. The kit is designed to reduce the stress at the fitting connection, plus the hoses are rated for higher pressure.

NOTES:

To order kit, contact the Tennant Customer Service Department at (800) 553-8033 or (763) 513-2850. The kit is covered under warranty. Follow the standard warranty claim process.

**Potential Hose Failure Location****Solution Hose Kit 9003386 Contents**

Part No.	Description	Qty.
9003385	Hose Assembly	1
54333	Clamp, Hose, Wormdrive	3
(not shown)		

