

Technical Service Bulletin

MODEL(S) AFFECTED: **Tennant M20 (machines serial numbers 2040 and below)**

SUBJECT: Premature Thermo-Sentry sensor (part number 367679) failure due to moisture damage. A damaged Thermo-Sentry sensor may cause a false **F5: Hopper Fire** fault code to display on the fault indicator, even if there is no fire in the hopper. If the Thermo-Sentry has failed, this fault code will reappear on the fault indicator, even after the machine is reset.

PURPOSE: Replace Thermo-Sentry sensor (367679) with an updated Thermo-Sentry sensor.

NOTES: Order Sensor Kit, Repair, Thermo-Sentry [M20]-9003444. The IB (Instruction Bulletin) for this kit is IB340849.

Refer to IB340849 included with the kit for all installation instructions.

Questions, contact the Tennant Customer Service Department at (800) 553-8033 or (763) 513-2850.

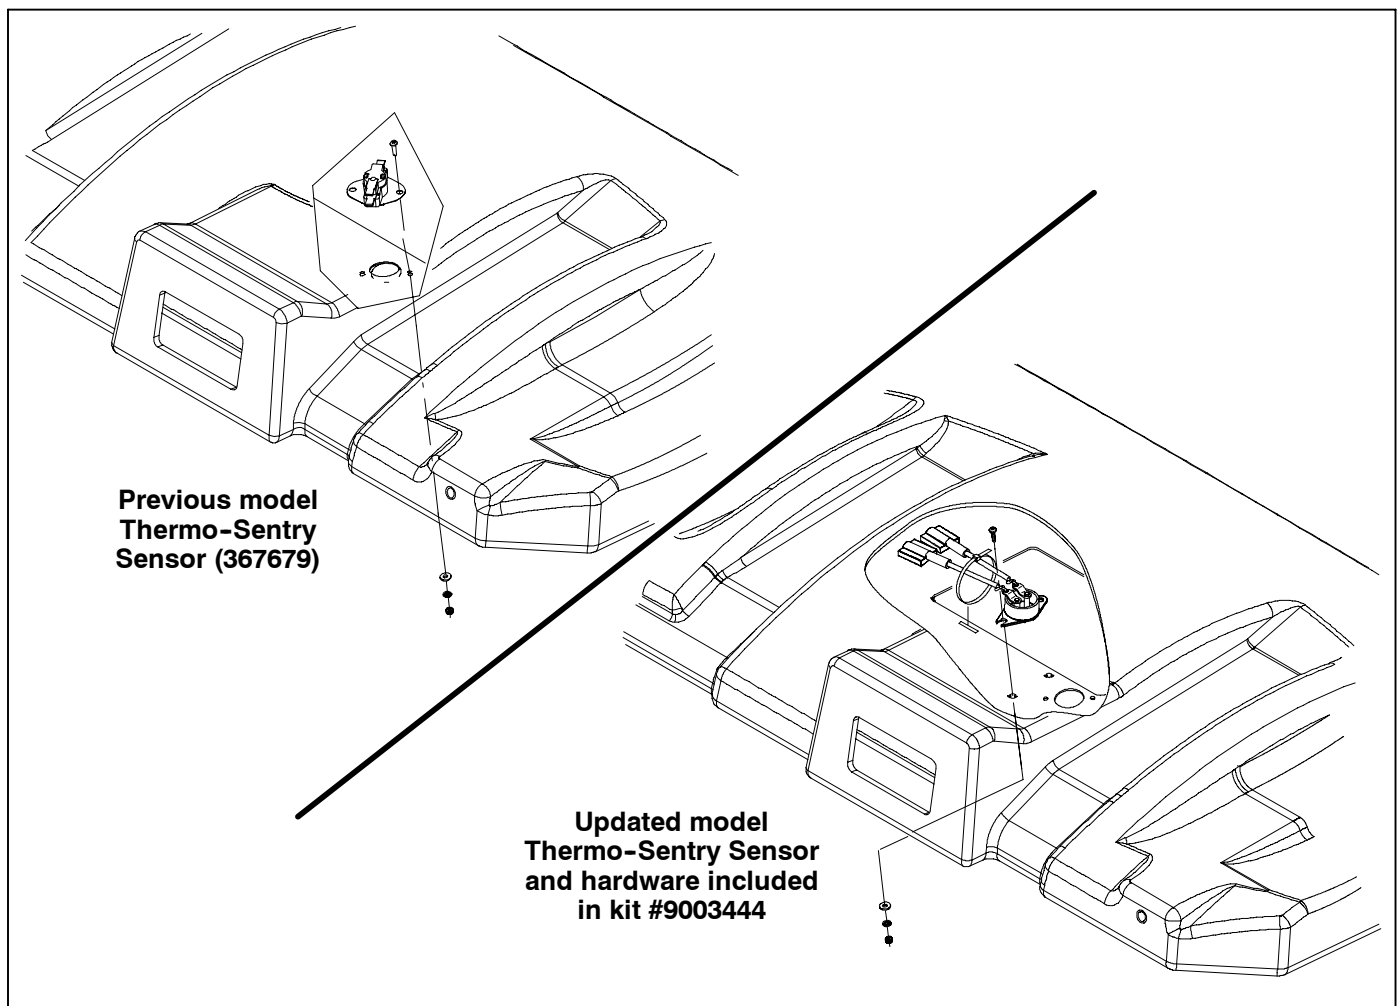


FIG. 1