


Technical Service Bulletin

MODEL(S) AFFECTED: Speed Scrub 17", 20" and 24" Models with Propel

SUBJECT: False Battery Discharge Indicator reading. If BDI charge level rapidly drops upon machine start up, the control board module may have a program error.
Note: The actual run time is not affected by false BDI reading, the batteries will continue to discharge as normal.

PURPOSE: To correct the BDI reading, replace the control board module with revision 03 (p/n 1052260). The revision level is located on module's label as shown below.

NOTES: For questions, contact the Tennant Customer Service Department at (800) 553-8033 or (763) 513-2850. **Warranty Information:** Standard warranty terms apply.

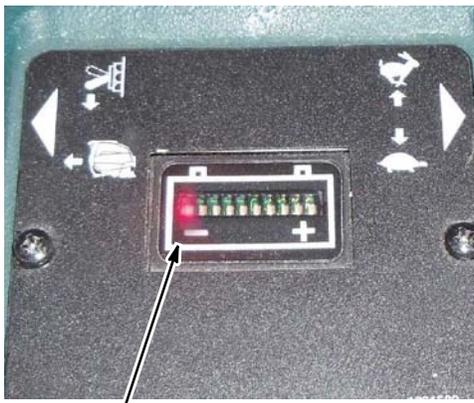

Replace control board module with Revision 03.

False BDI reading when batteries are fully charged. The actual run time is not affected by the false reading, the batteries will continue to discharge as normal.



Speed Scrub 17/20/24 (SS3)



Replacement Control Board Module Rev. 03 (p/n 1052260).

Note: The revision level 03 may be hand-written due to existing inventory was reprogrammed.