



Technical Service Bulletin

MODEL(S) AFFECTED: S9 Walk-Behind Sweeper
Machines manufactured before July, 2014.

SUBJECT: Rear brush linkage rattling sound.


PURPOSE: If you experience this condition, order the Rear Brush Linkage Upgrade Kit p/n 9013049. The upgrade kit includes new link arms equipped with nylon flange bushings to resolve rattle issue.

NOTES: **Warranty Information:** Standard warranty terms apply.

Left side rear brush linkage



Right side rear brush 2-piece linkage

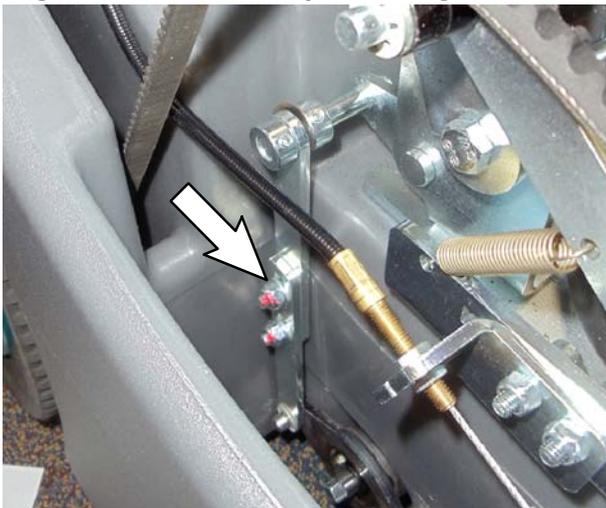

Upgrade Kit 9013049 Contents

Ref	Description	Qty.
1	RH Link Top w/ flange bushing	1
2	RH Link Bottom w/ flange bushing	1
3	LH Link w/ flange bushing	1
4	6mm Push Nut	2
5	M6 Flat Washer	2
6	M6 Nyloc Nut	2
Installation Instructions (IB 9013134)		

