

# Technical Service Bulletin


**MODEL(S) AFFECTED:** **T500e/T500 Scrubbers equipped with Smart-Fill™ ABW and Severe Environment system**  
Models manufactured before December, 2018

**SUBJECT:** The ABW and SE tank float switch may give a false indication of an empty tank.  
When the scrub head is in raised positioned, a magnetic field between the brush motor and float switch may cause the float switch to activate inadvertently.

**PURPOSE:** To prevent the above condition, order float switch shield kit (p/n 9018447).

**NOTES:** **Warranty Information:** Standard warranty terms apply.

False indication of an empty ABW and/or SE tank.

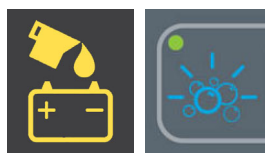

## Float Switch Shield Kit (p/n 9018447)

The float switch shield kit attaches to the float switch as shown below.

