Release Date: June 03, 2020



Technical Service Bulletin

MODEL(S) AFFECTED: T7 AMR Autonomous Rider Scrubber

Models manufactured before serial number 10981578 (April 3, 2020)

SUBJECT: Off-board charger interlock switch failure (i.e. damaged or loss of adjustment). The failure may occur if the

charger connector is roughly connected or disconnected to and from machine. Switch failure will prevent


machine from powering up.

PURPOSE: To prevent potential interlock switch failure, install Replacement Switch Kit 9020923.

The kit includes a guide connector bracket to protect switch from failure as shown below.


NOTES: Warranty Information: Standard warranty terms apply. All machines manufactured after April 3, 2020

are equipped with the guide connector bracket.

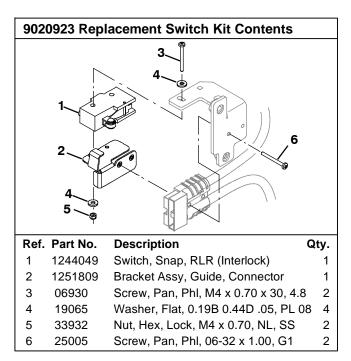



Before Kit Installed

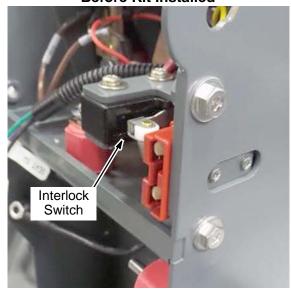

After Kit Installed

