

INSTRUCTION BULLETIN

No. 340361 Machine: 8300 Published: 12-2009

Rev: 01

NOTE: DO NOT DISCARD the Parts List from the Instruction Bulletin. Place the Parts List in the appropriate place in the machine manual for future reference. Retaining the Parts List will make it easier to reorder individual parts and will save the cost of ordering an entire kit.

NOTE: Numbers in parenthesis () are reference numbers for parts listed in Bill of Materials.

Installation instructions for kit number 386939 / 9006939

SYNOPSIS:

This kit contains the parts needed to install a 36V (1000AH) wet battery kit on the 8300 machine. Please follow step-by-step instructions.

SPECIAL TOOLS / CONSIDERATIONS: NONE

(Estimated time to complete: 1 hour)

PREPARATION:

FOR SAFETY: Before leaving or servicing machine, stop on level surface, set parking brake, turn off machine, and remove key.

- 1. Open the top battery compartment cover, and secure in position with the cover support rod.
- 2. Open the rear battery compartment door.
- 3. Disconnect battery pack from machine.



WARNING: Always disconnect battery cables from machine before working on electrical components.

INSTALLATION: (Refer to FIG. 1)

- 1. Remove the rear battery spacer from the rear of the compartment.
- 2. Remove the existing battery pack from battery compartment with chain hoist or lift.

NOTE: When servicing machine, use hoist or lift that will support the weight of the battery pack.

- 3. Install the right (2) and left (3) hand battery spacers on the sides of the battery compartment with hex screws (4), washers (5) and hex nuts (6). (Refer to FIG. 1)
- 4. Mount the rear battery spacer (4) in the rear of the battery compartment with hex screws (4), washers (5) and hex nuts (6). (Refer to FIG. 1)
- 5. Carefully install the new battery pack (1) into the battery compartment.
- 6. Connect the battery connector to the machine connector. Close the rear battery compartment door and the top battery compartment cover.
- 7. Reinstall the rear battery spacer into the rear of the battery compartment.

IB 340361 (12-2009)

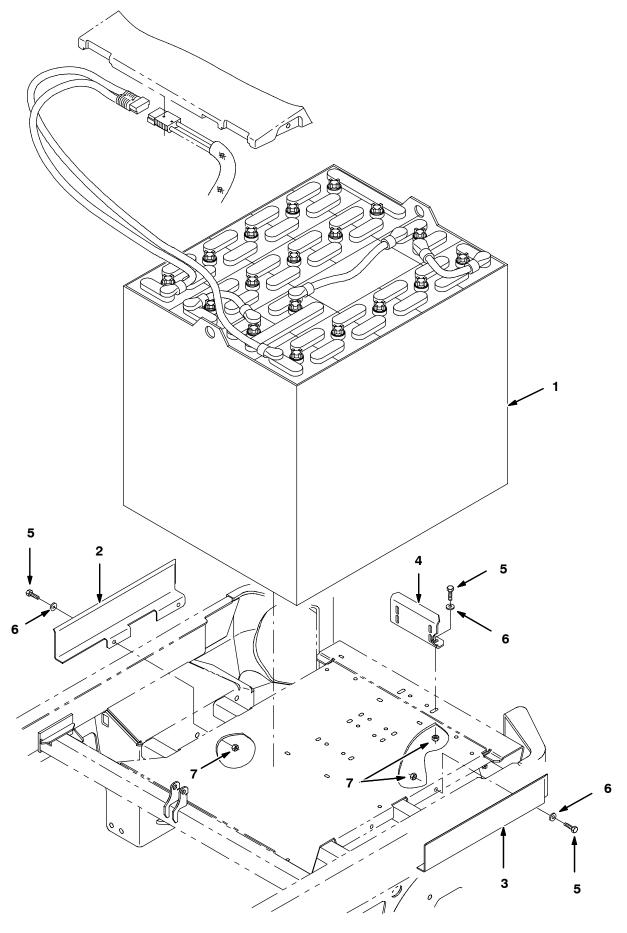


FIG. 1

| BILL OF MATERIALS FOR 36V, 1000AH, WET BATTERY KIT 386939 | | | | | |
|---|---------------------|---------------------------------|------|--|--|
| Ref. | TENNANT Part No. | Description | Qty. | | |
| 1 | 386337 | Battery, 36V (1000AH), Wet | 1 | | |
| 2 | 386677 | Spacer, Battery, RH | 1 | | |
| 3 | 386678 | Spacer, Battery, LH | 1 | | |
| 4 | 386575 | Spacer, Battery, Rear | 1 | | |
| 5 | 09740 | Screw, Hex, M08-1.25 X 20, SS | 6 | | |
| 6 | 01685 | Washer, Flat, .31, SS | 6 | | |
| 7 | 08713 | Nut, Hex, Lock, M08-1.25, NL,SS | 6 | | |

BILL OF MATERIALS FOR 36V, 1000AH, WET BATTERY KIT 9006939

| | TENNANT Part No. | | |
|------|---------------------|----------------------------------|------|
| Ref. | | Description | Qty. |
| 1 | 386337 | Battery, 36V (1000AH), Wet | 1 |
| 2 | 1056791 | Spacer, Battery, RH, Iron Gray | 1 |
| 3 | 1056790 | Spacer, Battery, LH, Iron Gray | 1 |
| 4 | 1056878 | Spacer, Battery, Rear, Iron Gray | 1 |
| 5 | 09740 | Screw, Hex, M08-1.25 X 20, SS | 6 |
| 6 | 01685 | Washer, Flat, .31, SS | 6 |
| 7 | 08713 | Nut, Hex, Lock, M08-1.25, NL,SS | 6 |

TENNANT COMPANY P. O. Box 1452 Minneapolis, MN 55440-1452

IB 340361 (12-2009) 3