

Technical Service Bulletin

**MODEL(S)
AFFECTED:****Tennant T7 Rider Scrubber**

Model serial number range: 10206994→10278484, (In Europe, before s/n T7.....0894)

SUBJECT:

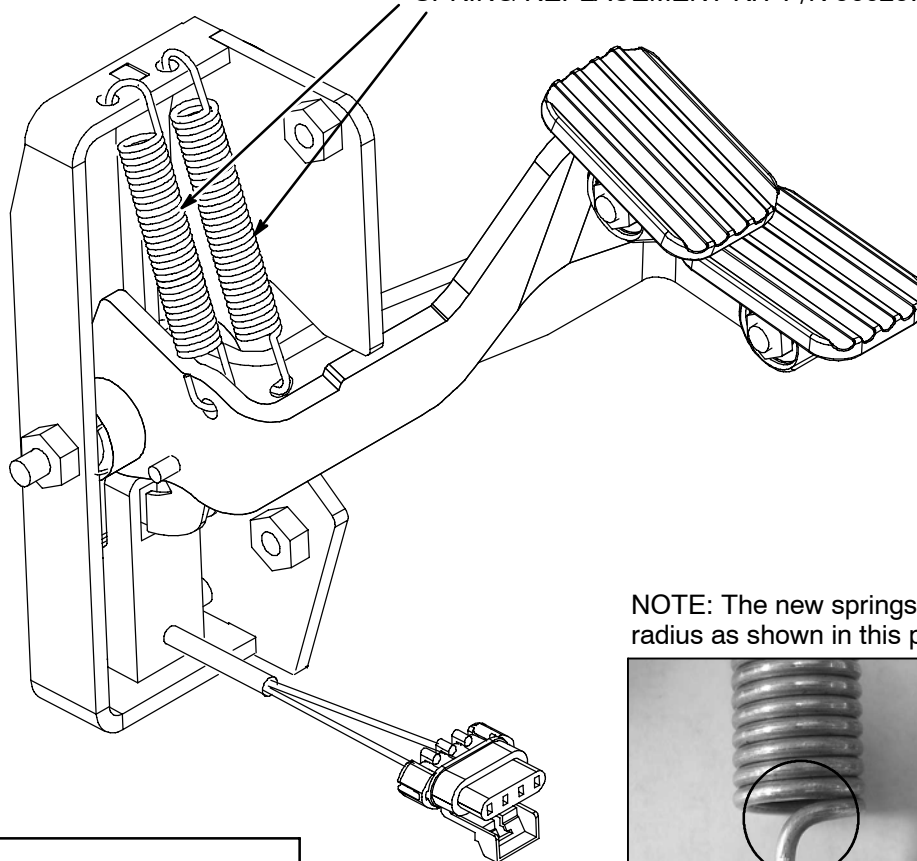
Potential accelerator pedal failure. Although this has occurred in less than 0.1% machines, Tennant mandates immediate machine repairs.

PURPOSE:

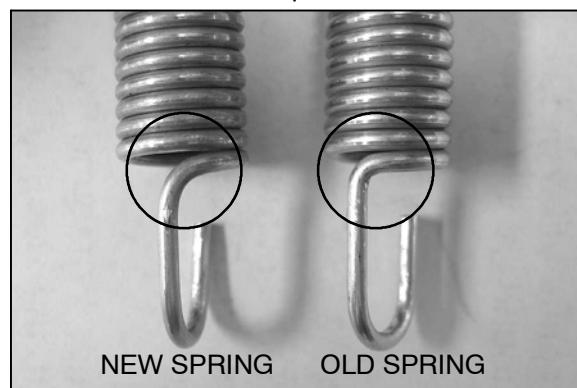
To ensure operator safety and risk of property damage from potential pedal malfunction. Tennant recommends to discontinue machine use until the below spring replacement kit has been installed.

NOTES:9002672 - Kit, Accelerator and Brake Pedal Spring Replacement - Kit includes 2 springs and installation instructions. Kit and installation expense will be covered by Tennant.

For questions, contact the Tennant Customer Service Department at (800) 553-8033 or (763) 513-2850.

DISPOSE EXISTING SPRINGS AND INSTALL
SPRING REPLACEMENT KIT P/N 9002672

NOTE: The new springs have a larger bend radius as shown in this photo.

**Service Repair Note:** Please include the following on the repair form.

Authorization: TSB122

Account: 312

Labor Time: 1 hr