

Technical Service Bulletin

MODEL(S) AFFECTED: Tennant M20, T20, T7, T5, T3 (Only machines equipped with FaST)

SUBJECT: Hoses on FaST-PAK cartons kinking when the FaST-PAK carton is installed onto the machine, restricting or stopping the flow of detergent to the detergent pump.


PURPOSE: Install conduit onto FaST-PAK carton hose to prevent the hose from kinking.

NOTES: Order Conduit Kit, FaST-PAK (9003292) for the conduit needed to keep the FaST-PAK carton hose from kinking. The Instruction Bulletin included with this kit is IB 340843.


Do Not Discard the conduit (1) with the old FaST-PAK carton when changing the carton. The conduit must be removed from the old FaST-PAK carton and installed onto the new FaST-PAK carton before the new carton is installed onto the machine.

The conduit does not need to be installed onto FaST-PAK cartons equipped with factory installed conduit. Disregard this TSB if the FaST-PAK carton is equipped with factory installed conduit.

Questions, contact the Tennant Customer Service Department at (800) 553-8033 or (763) 513-2850.

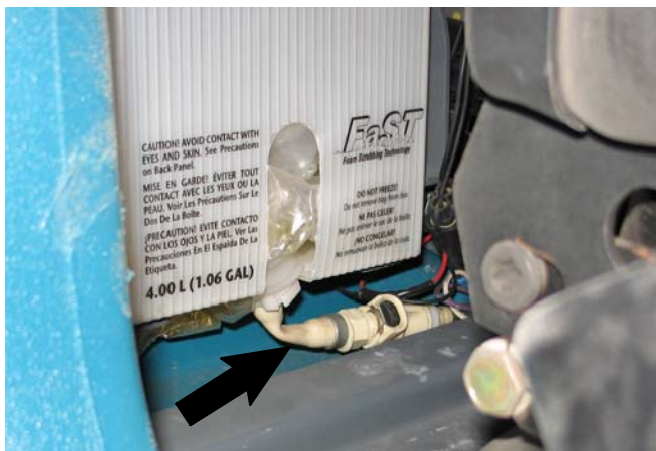

FaST-PAK carton hose must not be kinked as shown above.

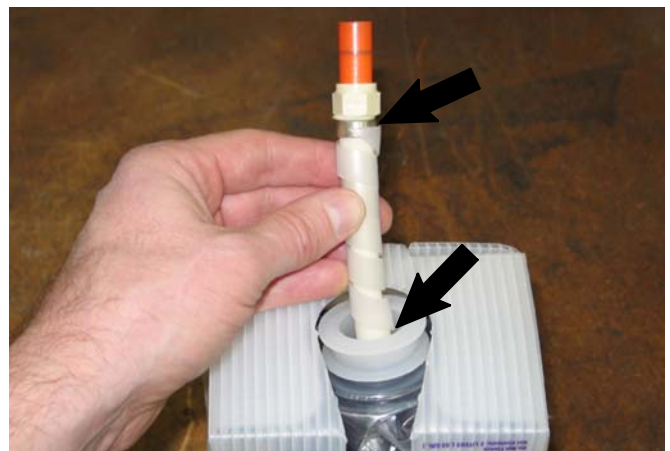

Install conduit onto FaST-PAK carton hose to prevent hose from kinking.

Do Not Discard the conduit (1) with the old FaST-PAK carton when changing cartons. The conduit must be removed from the old FaST-PAK carton and installed onto the new FaST-PAK carton before the new carton is installed onto the machine.

The conduit does not need to be installed onto FaST-PAK cartons equipped with factory installed conduit. Disregard this TSB if the FaST-PAK carton is equipped with factory installed conduit.