

Technical Service Bulletin


MODEL(S) T7 Rider Scrubber (disk model)
AFFECTED:

SUBJECT: Potential water leak at solution valve. When scrub deck is raised, the machine's wire harness located above the solution valve may come in contact with the valve causing it to disassemble as shown below. The solution valve is designed to disassemble to allow different orientations by turning the valve body.

PURPOSE: To prevent the above condition, the machine's wire harness should be cable-tied to the machine frame as described below to allow clearance for the solution valve when scrub deck is raised.

NOTES: When servicing machine on a non-related issue, check wire harness to ensure it's cable-tied to machine frame as shown below.

Warranty Information: Standard terms apply.

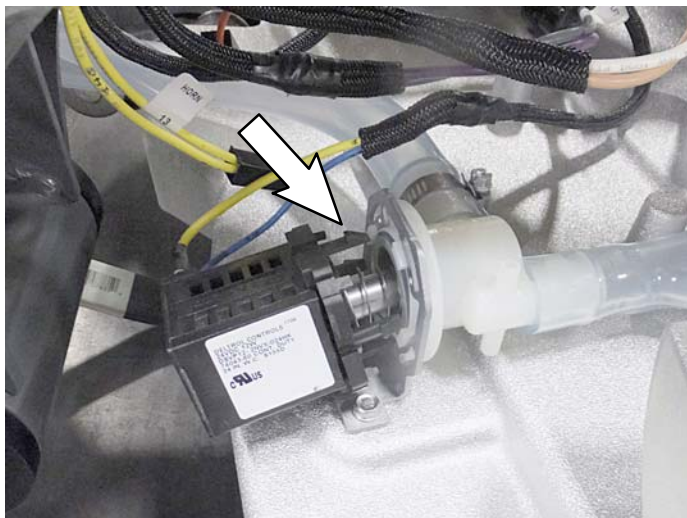

Solution valve disassembled.



To prevent wire harness from coming in contact with the solution valve, secure the wire harness to the machine frame grommet with a cable-tie as shown.